

CD50 analog output – Measurement range 0 up to 1250 mm

Specifications:

Measurement range	0 up to 1250 mm
Output signal	0...10V (galvanic isolation) 4...20mA current loop 4...20mA current generator (galvanic isolation) 0...20mA current generator (galvanic isolation)
Resolution	Quasi infinite (depends on the operating system)
Material	Body and cover - aluminium (RohS) Measuring cable – Stainless steel
Cable diameter	0,51 mm
Detection element	Multi-turn Hybrid potentiometer
Connection	Male connector M16 – DIN 8 pin Male connector M12 – 4 pin PVC cable – 4 wires
Standard linearity	+/- 0,25% f.s. – stroke ≤500mm +/- 0,15% f.s. – stroke >500mm +/- 0,10% f.s. – stroke >500mm (option)
Protection class	IP54 (option IP67)
Max. Velocity	10 M/S
Max. Acceleration	40 M/S ² (before cable deformation)
Weight	≈ 700 g
Operating temperature	-20° to +80°C
Storage temperature	-30° to +80°C



Cable forces:

Measurement range in mm	Min. pull-out force	Max. pull-out force
50	≈ 6,40 N	≈ 6,50 N
100	≈ 6,30 N	≈ 6,50 N
250	≈ 6,00 N	≈ 6,50 N
500	≈ 5,50 N	≈ 6,50 N
750	≈ 5,00 N	≈ 6,50 N
1000	≈ 4,50 N	≈ 6,50 N
1200	≈ 4,00 N	≈ 6,50 N
1250	≈ 4,00 N	≈ 6,50 N

Ordering reference:

	CD50					OP	
Model							
CD50							
Measurement range							
0050	= 0 up to 50 mm						
0100	= 0 up to 100 mm						
0250	= 0 up to 250 mm						
0500	= 0 up to 500 mm						
0750	= 0 up to 750 mm						
1000	= 0 up to 1000 mm						
1200	= 0 up to 1200 mm						
1250	= 0 up to 1250 mm						
(Other range available on demand)							
Output signal							
U010	= 0...10V						
I420	= 4...20mA (current loop)						
I420G	= 4...20mA (current generator)						
I020G	= 0...20mA (current generator)						
Linearity							
L25	= +/- 0.25% f.s. (standard for measuring range from 0 up to 500mm)						
L15	= +/- 0.15% f.s. (standard for measuring range greater than 500 mm)						
	(option for measuring range from 0 up to 500mm)						
L10	= +/- 0.10% f.s. (option for measuring range greater than 500 mm)						
Connection							
C	= Male connector M16 – DIN 8 pin						
L4	= Male connector M12 – 4 pin						
K	= PVC cable – 4 wires + ex: 02 for cable 2 meters long						
OP Options							
AC	= Complete anodizing						
BT	= Low temperature (down to -30°C)						
CP	= Fixing of the measuring cable with a clevis						
EM	= Fixing of the measuring cable with a clip						
EN	= Measuring cable coated with polyamide						
IP67	= Protection class IP67						
M4	= Fixing of the measuring cable with a M4 threaded rod						
RAC	= Cable dust wiper						
TEV	= Water evacuation holes						

Reference example: CD50-0750-U010-L15-K02-OP-AC-EM





Tel : +33 (0)3 88 02 09 02 / Fax : +33 (0)3 88 02 09 03 / E-mail : info@ak-industries.com / Web : <http://www.ak-industries.com>

Electrical characteristics :



Analog version 0 ... 10V :

Input voltage	15 to +27 Vdc (52mA max)
Output voltage	0 to 10 Vdc
Output current	10mA max
Galvanic isolation	3KV
Protection	- Short circuit - Polarity reversal
Temperature drift	+/-100 ppm/°C

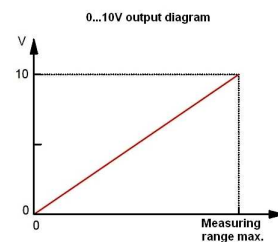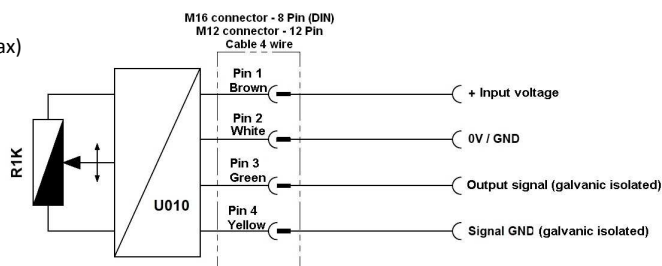



Analog version 4 ... 20mA : (Current loop)

Input voltage	+15 to +27 Vdc (32mA max)
Output current	4 to 20mA
Protection	- Short circuit - Polarity reversal
Temperature drift	+/-100 ppm/°C

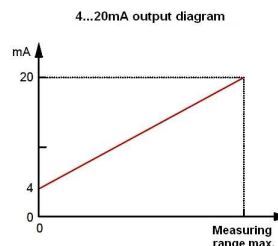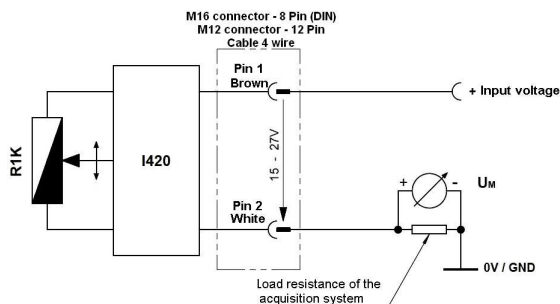

Analog version 4...20mA or 0...20mA : (Current generator)

Input voltage	+15 to +27 Vdc (75mA max)
Output current	4 to 20mA or 0 to 20mA
Output current	22 mA max.
Galvanic isolation	3KV
Protection	- Short circuit - Polarity reversal
Temperature drift	+/-100 ppm/°C

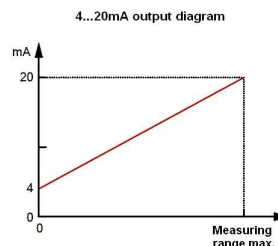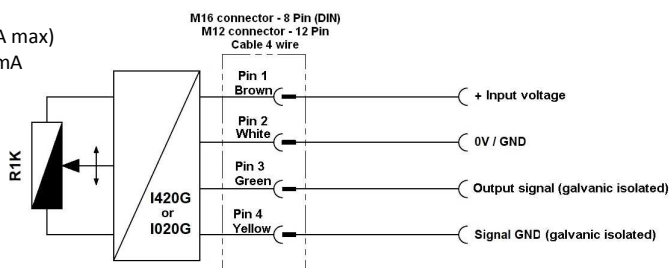

Connection :

Male connector M16 8 pin (DIN)	Male connector M12 4 pin (DIN)	PVC cable 4 wire	010V	I420 (current loop)	I420G or I020G (current generator)
1	1	Brown	Input voltage +	Signal +	Input voltage +
2	2	White	Input voltage GND	Signal -	Input voltage GND
3	3	Green	Signal +		Signal +
4	4	Yellow	Signal GND		Signal GND


<p>Sensor side view</p>	<p>Sensor side view</p>
-------------------------	-------------------------

Options :

Cable attachment with a lug :

Standard


The attachment lug is fixed with a M6 screw or a clevis.

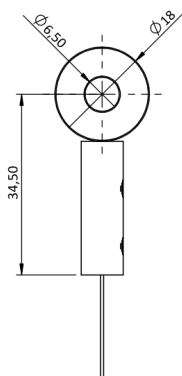

Cable attachment with a clip :

OP-EM

This fastening system allows a rotation about its axis.
The clip is fixed with a M4 screw or a clevis.

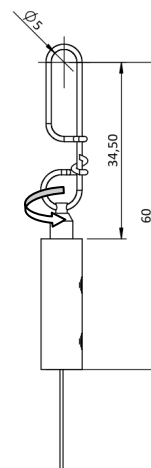


Cable attachment with a M4 threaded rod:

OP-M4

The rod attachment uses a threaded rod with 2 nuts (provided).
The required thickness of the plate does not exceed 5 mm.

Caution


Never screw the threaded rod into a fixed nut, a twist of the measurement cable would damage it.

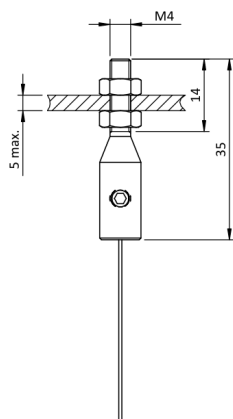

Cable attachment with a clevis :

OP-CP


The attachment of the clevis is done using a pin (provided).

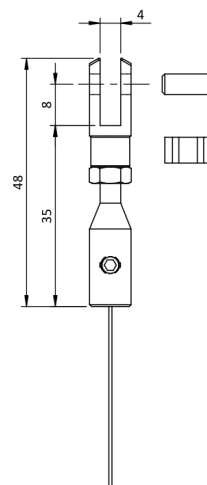

Cable dust wiper:

OP-RAC


The dust wiper cleans the cable in dusty or humid environments.

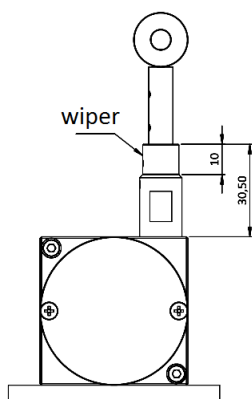



Water evacuation holes:

OP-TEV


The holes allow the natural flow of fluids out of the sensor in order to avoid their accumulation in the system.

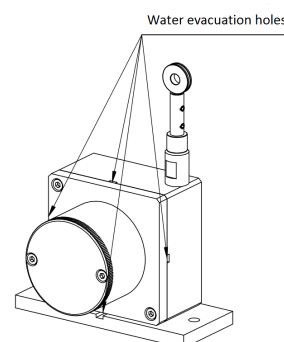


Dimensional Drawing

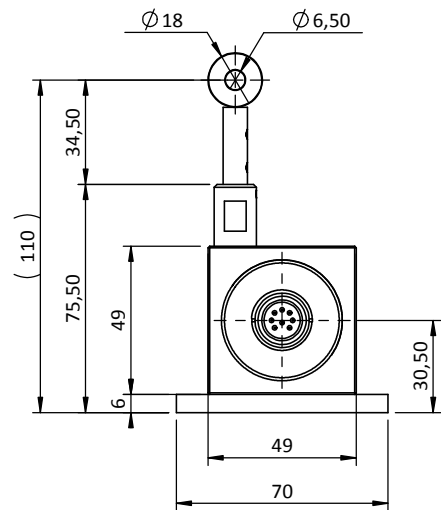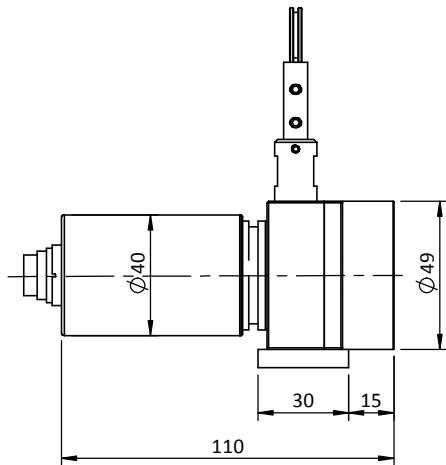

K Connection
(PVC cable - 4 wires)

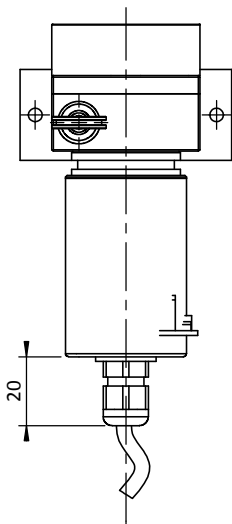

L4 connection
(connector M12 - 4 pin)

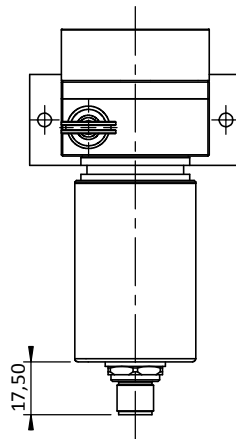

C connection
(Connector M16 - DIN 8 pin)

